

DEFECT LOCATION IN SUPERCONDUCTING CAVITIES COOLED WITH HE-II USING OSCILLATING SUPERLEAK TRANSDUCERS*

Z.A. Conway[#], D.L. Hartill, H.S. Padamsee, and E.N. Smith, CLASSE, Cornell University, Ithaca, NY, 14853, U.S.A.

Abstract

Superconducting RF cavity quench detection is presently a cumbersome procedure requiring two or more expensive cold tests. One cold test identifies the cell-pair involved via quench field measurements. A second test follows with numerous fixed thermometers attached to the culprit cell-pair to identify the particular cell. A third measurement with many localized thermometers is necessary to zoom in on the quench spot. We report here on a far more efficient alternative method which utilizes a few (e.g. 8) oscillating superleak transducers (OST) to detect the He-II second sound wave driven by the defect induced quench. Results characterizing defect location with He-II second sound wave OST detection, corroborating measurements with carbon thermometers, and second sound aided cavity repairs will be presented.

INTRODUCTION

Due to major R&D efforts by many laboratories within the TESLA Technology Collaboration (TTC), DESY and JLAB have now successfully tested more than 20 cavities over 35 MV/m [1, 2]. Nevertheless the means for reliably producing cavities which achieve accelerating gradients >35 MV/m with a high yield remains to be demonstrated as one of the ILC highest priority R&D goals. Frequently, the cavity gradients are limited by defects on the RF surface which quench at field levels well below 35 MV/m. Such quench limited cavities may be repairable but the process of locating defects in 9-cell cavities remains a lengthy and cumbersome process.

Many laboratories are developing large scale thermometry systems to pin-point the quench locations. Here, we present a cost-effective and simple method to determine quench locations (defects). By testing a superconducting cavity in a superfluid helium bath it is possible to observe second-sound temperature waves driven by the conversion of stored RF energy to thermal energy at the defect [3, 4]. By measuring the time-of-arrival of the second sound wave at three or more detectors the defect location can be unambiguously determined in three dimensions. Here, we use oscillating superleak transducers (OST), which measure the fluctuating superfluid helium counterflow velocity, to detect the time of arrival of second sound waves [5, 6, 7].

This paper is split into four parts. First, we introduce the second sound detection system and present an example of the data used to locate defects. Second, we present results from direct thermometric measures of the

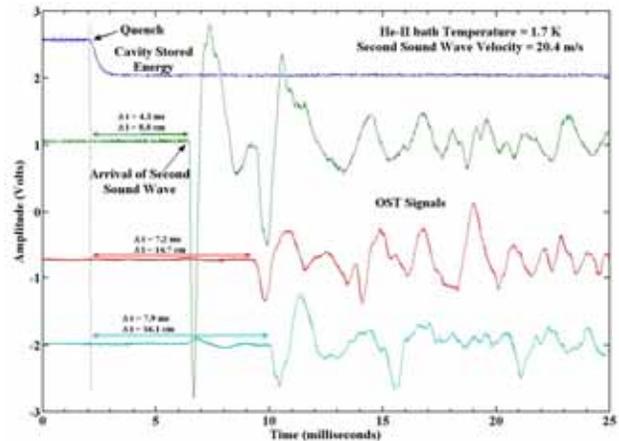


Figure 1: A typical quench event observed with three different transducers. The top trace is the amplitude of the cavity RF field. The lower three traces are the second sound signals measured with 3 distinct OST. The variation in the second sound wave time-of-arrival is well correlated with the variation in propagation distance to each transducer.

cavity outer surface which corroborate the second sound defect location. Third, we give two examples where second sound measurements initiated the successful repair of superconducting cavities and where multiple defects were located in a single cold test. Finally, we conclude with a brief summary of the impact of the work presented.

SECOND SOUND DETECTION

The abrupt dissipation of the stored RF energy during quench can be a symptom of a surface defect. In each cavity cold test an array of OST are employed to locate the defect. A typical OST arrangement uses 8 transducers evenly distributed around the cavity. The OST employed here are parallel-plate capacitors with one rigid plate and one flexible-porous plate. The pore diameter is chosen to clamp the flow of the normal fluid while allowing the superfluid, with zero viscosity, to pass freely. The arrival of a second sound wave at the OST causes the flexible-porous-plate to move with the normal fluid as the second sound wave passes. The capacitance of the detector is continuously monitored to measure the arrival of the second sound wave.

Figure 1 shows the experimental data from an observed quench at 1.7 K. The top, step-like, trace shows the cavity field amplitude in a single-cell TESLA-style cavity, which was excited with an RF pulse to $E_{acc} = 28$ MV/m. At this accelerating gradient the resonator quenched and the RF field decays. The lower three traces show the signals measured with three distinct OST

*Work supported by The U.S. Department of Energy and The National Science Foundation.

[#]zac22@cornell.edu

immersed in the superfluid helium bath with the cavity. For clarity the other five transducer signals are not shown. In figure 1, the OST detect the arrival of the second sound wave 4.3 ms, 7.2 ms, and 7.9 ms after quench. This indicates that the defect in the cavity is 8.8 cm, 14.7 cm, and 16.1 cm from each OST respectively. Please note, this picture is representative of many quench events and the process is highly repeatable.

Using this method the defect location is determined to an area with a radius of 2-3 cm. Alternatively, using the second sound wave velocity as a free parameter and searching for the point where the signals converge improves the defect location estimate by a factor of ~ 2 . Once the defect location is known the cavity interior is optically inspected and a course of repair can be determined.

THERMOMETRIC DEFECT LOCATION

The comparison of second sound and steady state thermometric measurements for a defect located on a 9-cell reentrant cavity were reported on in [4]. This result demonstrated the correlation between second sound and fixed thermometer array defect location. However, due to a failure of the input coupler feedthrough from very high power application during testing we were only able to weakly couple to the cavity. The maximum achievable accelerating gradient was limited to 8 MV/m in the cell with the defect.

Here we compare the results of second sound and thermometric measurements performed at field amplitudes around the quench field. Both, steady state and static measurements are presented.

Figure 2 compares the second sound defect location to the actual defect's temperature distribution for a cavity excited to a field amplitude of $E_{acc} = 23$ MV/m just below the quench field of 24 MV/m. There are two sets of data shown here:

- The temperature rise of the cavity outer surface measured with a thermometer array centered on the second sound determined defect-location, the solid points with error bars.
- The estimated heating due to a simulated defect from thermal model codes [8], the continuous line.

The horizontal axis is the radial distance away from the defect location determined by second sound. The vertical axis is the temperature rise due to heating, the difference between the measured temperature at $E_{acc} = 23$ MV/m and the measured temperature when the cavity is not excited. Notice, the defect location determined by thermometric measurements agrees with the second sound measurements to ~ 5 mm.

Figure 3 compares the dynamic heating of the cavity to the detection of second sound waves. There are three sets of data shown. The top trace is the amplitude of the cavity RF field. The middle trace is the signal from an OST located 8.2 cm away from the defect in the helium bath. The lower trace is the cavity surface heating measured with a carbon thermometer in contact with the

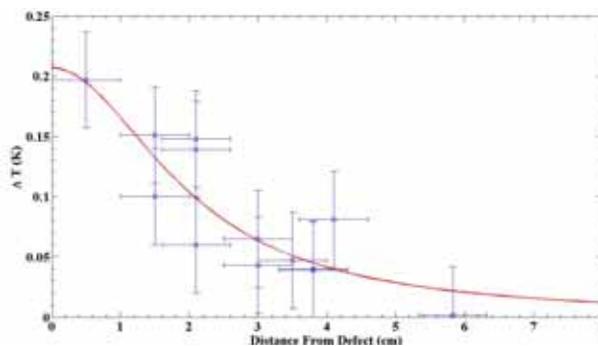


Figure 2: An example of the spatial distribution of cavity heating due to a defect.

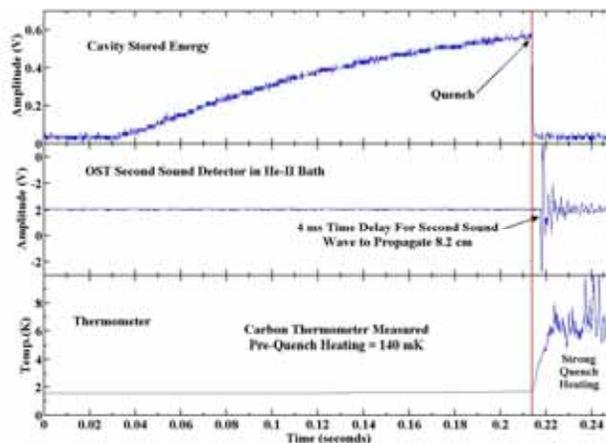


Figure 3: A single quench event measured with an OST in the He-II bath 8.2 cm away from the cavity defect and with a carbon thermometer attached to the cavity surface 2 cm away from the cavity defect.

cavity outer surface and 2 cm away from the defect. During quench the cavity heats to >9 K, the critical temperature of niobium. The second sound detector does not measure the arrival of the second sound wave (heat) until after it propagates to the OST. Notice the change in temperature scale between figures 2 and 3. The thermometer in figure 3 heats 140 mK just before quench, an amount only barely visible on this scale. After quench it warms up, 6K is the upper temperature limit of the electronics used for this measurement.

SECOND SOUND APPLICATION EXAMPLES

In the past year the second sound defect location system led to the location and characterization of many defect limited cavities. Three of these cavities were repaired. We will briefly review these results in this section and comment on the status of another cavity awaiting repair.

First, two single-cell cavities were defect limited due to a flaw in the die used to form the cavities. The initial cold tests found these cavities defect limited and second sound measurements located the defects to the same spot on the cavity surfaces. Subsequent optical inspection found a strange bump which was quickly determined to be due to a flaw in the die used to form the cavities. Removing the

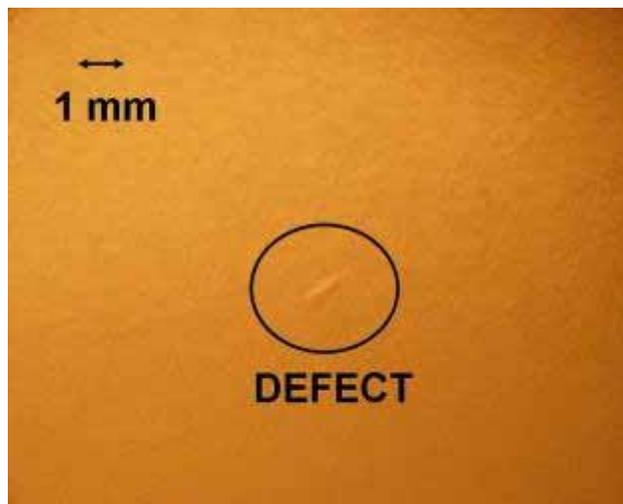


Figure 4: Defect located with second sound.

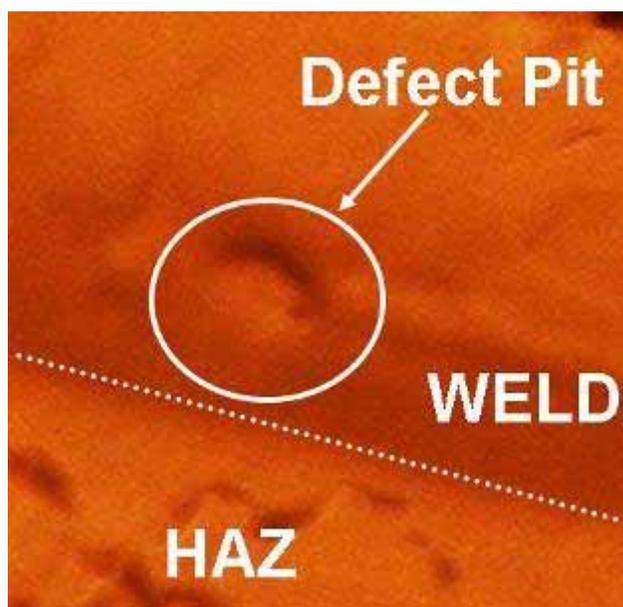


Figure 5: Defect located with second sound on a cavity equator weld. The defect is circled and the weld and heat affect zone (HAZ) are labeled [9].

bumps with BCP etching removed the defects and increased the cavity quench fields. Figure 4 shows the cavity defect. This defect was located with second sound measurements with a single cold test. For both cavities, fixing the defect increased the cavity accelerating gradient from ~ 20 MV/m to ~ 30 MV/m.

In another example, second sound measurements located a pit-defect on the equator weld of a reentrant 9-cell cavity, reported on in [9]. Note that this pit is on the weld and not in the heat affected zone. This cavity was tumbled, removing just enough material to eliminate the weld pit. After reprocessing the cavity accelerating gradient exceeded 30 MV/m; previously the defect-limited cavity quenched at 15 MV/m [9].

It is interesting to note that exciting different eigenmodes of multi-cell cavities has been used to locate multiple defects. During a test of an ILC 9-cell cavity

defects were found in three different cells. This was done by powering different modes of the TM_{010} passband during a single cold test. This cavity is currently waiting for optical inspection [10].

SUMMARY

Locating cavity defects, which cause quench, with second sound measurements is a simple and powerful technique. In one cold test cavity defects are located with a small amount of hardware which is easy to integrate into a vertical test. It is shown that second sound telemetry is well correlated with direct thermometric mapping of the cavity outer surface. This eliminates the need for repeated testing, accommodating thermometric measurements to localize the defect location.

Cornell has successfully used this technique over 30 times in the past year and successfully repaired three cavities, with more second sound guided cavity repairs forthcoming.

ACKNOWLEDGEMENTS

We extend many thanks to Nick Szabo for all of his help in preparing and testing the 2nd sound transducers and electronics in the Physics 510 teaching laboratory.

REFERENCES

- [1] L. Lilje, "R&D In RF Superconductivity To Support The International Linear Collider," PAC 07, Albuquerque, NM, June 2007, Pg. 2559; www.jacow.org.
- [2] R.L. Geng, "Progress on Improving SC Cavity Performance for ILC," TU3RAI03, these proceedings.
- [3] K.W. Shepard, et al, "Development And Production Of Superconducting Resonators For The Argonne Heavy Ion Linac," IEEE Trans. Mag., MAG-15, Pg. 666, (1979).
- [4] Z.A. Conway, et al, "Oscillating Superleak Transducers For Quench Detection in Superconducting ILC Cavities Cooled with He-II," LINAC 2008, Victoria, British Columbia, Canada, September 2008, THP036, To Be Published.
- [5] R.A. Sherlock and D.O. Edwards, "Oscillating Superleak Second Sound Transducers," Rev. Sci. Instrum. 41, Pg. 1603 (1970).
- [6] R. Williams, et al, "The Velocity Of Second Sound Near T_λ ," Phys. Lett. 29A, Pg. 279 (1969).
- [7] D.L. Hartill, et al, To Be Published.
- [8] J.C. Amato, "Spatial Resolution of Residual Resistance Using Thermometer Arrays," Cornell LEPP report SRF-840506 (1984).
- [9] Z.A. Conway, et al, "Multi-Cell Reentrant Cavity Development and Testing at Cornell," TU5PFP047, these proceedings.
- [10] Z.A. Conway, et al, "ILC Cavity Testing Program at Cornell University," TU5PFP046, these proceedings.